

Manhole Inspection Summary

Manhole # S33AA1004MH

Printed On: 12/17/2008

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **33AA1** Node: **004** Status: **Found**

Insp Date: **3/5/07 2:26 PM**

Incomplete Comments

Crew: **BC, JC**
Inspector: **Creary, B**
Firm: **RKK**

Location Address: **3409 GREENWAY**

Cross Street: **UNIVERSITY PKWY**

Manhole Type: **Junction**

Location: **Sidewalk**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Concrete**

☐ Parged Height: **4** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☒ **Roots** ☒ **Wall**

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **42** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged ☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

☐ Debris (not Condition related)

Channel Exposure: **Fully Open**

Junc Dist: **0**

nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☒ **Deteriorated** ☐ Leaks ☐ Debris

Steps

Count: **4** Missing: **0** ☐ Corroded

Surcharge

☐ Evidence Of Surcharge

Depth:

(ft.)

☐ Active Surcharge Present

Location View



Top View



Bench debris.

Defect



Adjustment infiltration. Corbel root intrusion and infiltration.

Manhole Inspection Summary


Manhole # S33AA1004MH

Printed On: 12/17/2008

Page 3 of 4

8 in. Circular Gravity Sewer

Pipe Out @ 12 O'Clock

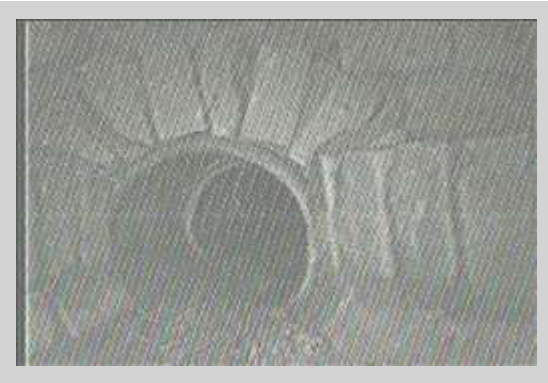

Barrel deterioration and infiltration. Channel deterioration.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.94** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ **Debris** ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

Pipe In @ 3 O'Clock



Channel deterioration and root intrusion.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.65** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ **Debris** ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S33AA1004MH

Printed On: 12/17/2008

Page 4 of 4

8 in. Circular Gravity Sewer

Pipe In @ 9 O'Clock



Barrel deterioration and infiltration.

Drop In @ 9 O'Clock



Barrel deterioration and infiltration. Channel deterioration.

Rod and Bar (Angled)

Pipe Material: **Clay**

☐ Pipe Lined

Invert Depth: **6.55** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **0** (in.)

Deposits Extent: **Light**

Infiltration: **None**

Pipe Seal Cond: **Cracked**

Drop: **Outside** **Rod and Bar**

Angled: **Yes** Reading: **7.63** (ft.)

Inv Depth: **8.63** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection